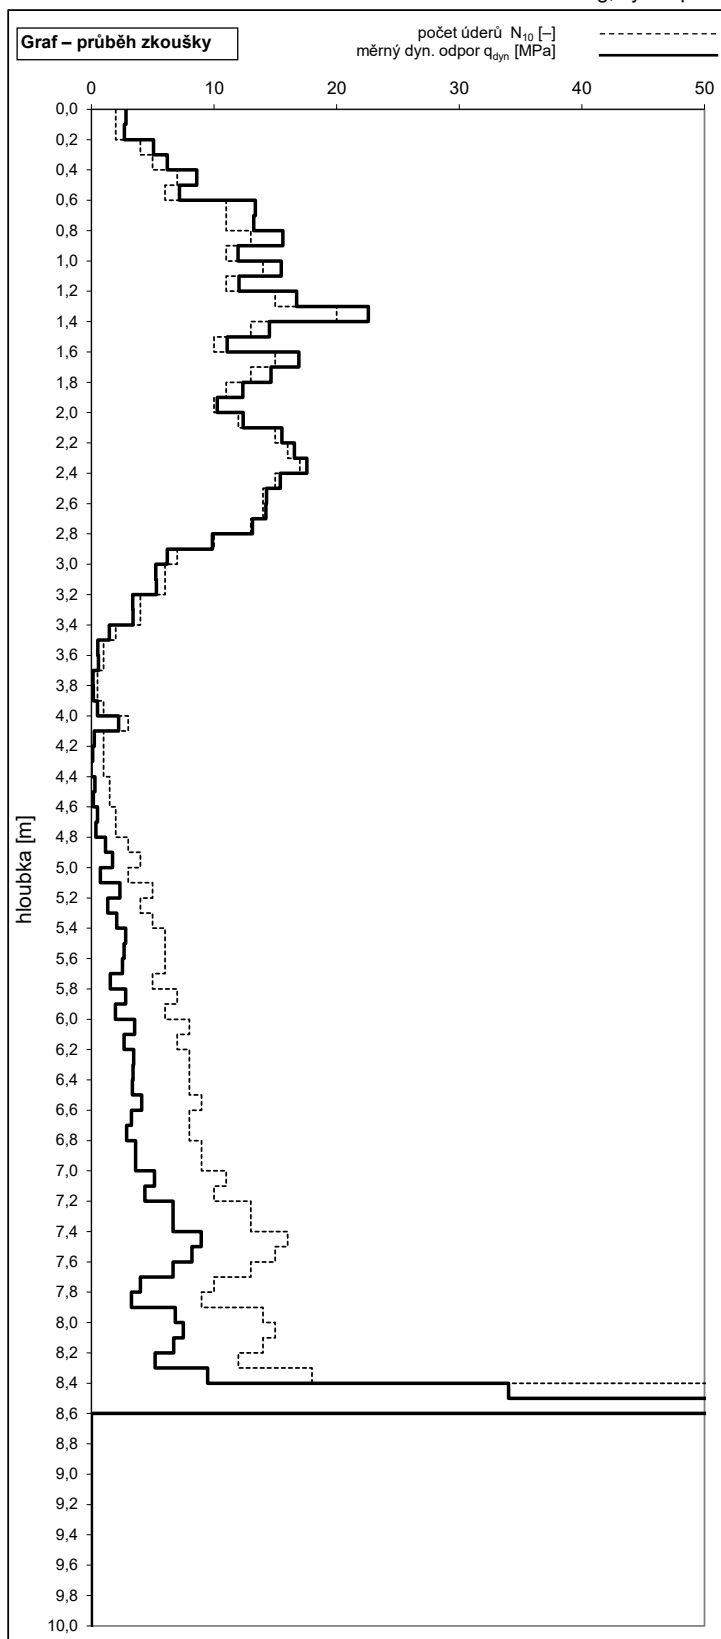


Dynamická penetrační zkouška DP 1hmotnost beranidla 50 kg, výška pádu 0,5 m, průřez hrotu 15 cm²**Tabulka – výsledky měření**

hloubka [m]	N_{10} [–]	M_v [Nm]	q_{dyn} [MPa]
0.1	2		2.8
0.2	2		2.7
0.3	4		5.1
0.4	5		6.2
0.5	7		8.6
0.6	6		7.2
0.7	11		13.4
0.8	11		13.2
0.9	13	30	15.6
1.0	11		12.0
1.1	14		15.5
1.2	11		12.1
1.3	15		16.7
1.4	20		22.6
1.5	13		14.5
1.6	10		11.1
1.7	15		16.9
1.8	13		14.6
1.9	11	20	12.4
2.0	10		10.3
2.1	12		12.4
2.2	15		15.5
2.3	16		16.6
2.4	17		17.6
2.5	15		15.4
2.6	14		14.3
2.7	14		14.2
2.8	13		13.1
2.9	10	30	9.9
3.0	7		6.2
3.1	6		5.3
3.2	6		5.3
3.3	4		3.4
3.4	4		3.4
3.5	2		1.5
3.6	1		0.5
3.7	1		0.6
3.8	1		0.1
3.9	1	20	0.2
4.0	1		0.5
4.1	3		2.2
4.2	1		0.2
4.3	1		0.1
4.4	1		0.0
4.5	2		0.3
4.6	2		0.2
4.7	2		0.5
4.8	2		0.4
4.9	3	50	1.1
5.0	4		1.7
5.1	3		0.7
5.2	5		2.3
5.3	4		1.3
5.4	5		2.1
5.5	6		2.8
5.6	6		2.7
5.7	6		2.5
5.8	5		1.5
5.9	7	80	2.8
6.0	6		2.0
6.1	8		3.5
6.2	7		2.7
6.3	8		3.4
6.4	8		3.4
6.5	8		3.4
6.6	9		4.1
6.7	8		3.3
6.8	8		2.9
6.9	9	90	3.6
7.0	9		3.6
7.1	11		5.1
7.2	10		4.4
7.3	13		6.7
7.4	13		6.7
7.5	16		9.0
7.6	15		8.2
7.7	13		6.7
7.8	10		4.0
7.9	9	90	3.3
8.0	14		6.8
8.1	15		7.5
8.2	14		6.7
8.3	12		5.2
8.4	18		9.5
8.5	52		34.0
8.6	100	100	68.7

SG Geotechnika a.s.

Geologická 988/4, 152 00 Praha 5

tel.: +420 234 654 111 fax: +420 234 654 112 e-mail: info@geotechnika.cz

Objednatel:	Geotechnika Ďurove, s.r.o.			
Název zakázky:	Karlovy Vary DP			
Číslo zakázky:	Měřili:	Zpracoval:	Schválil:	Datum:
23.0027.255Z28	A. Horváth, M. Datel	L. Domin	Ing. M. Kvarda	30.1.2023
Poznámka:				