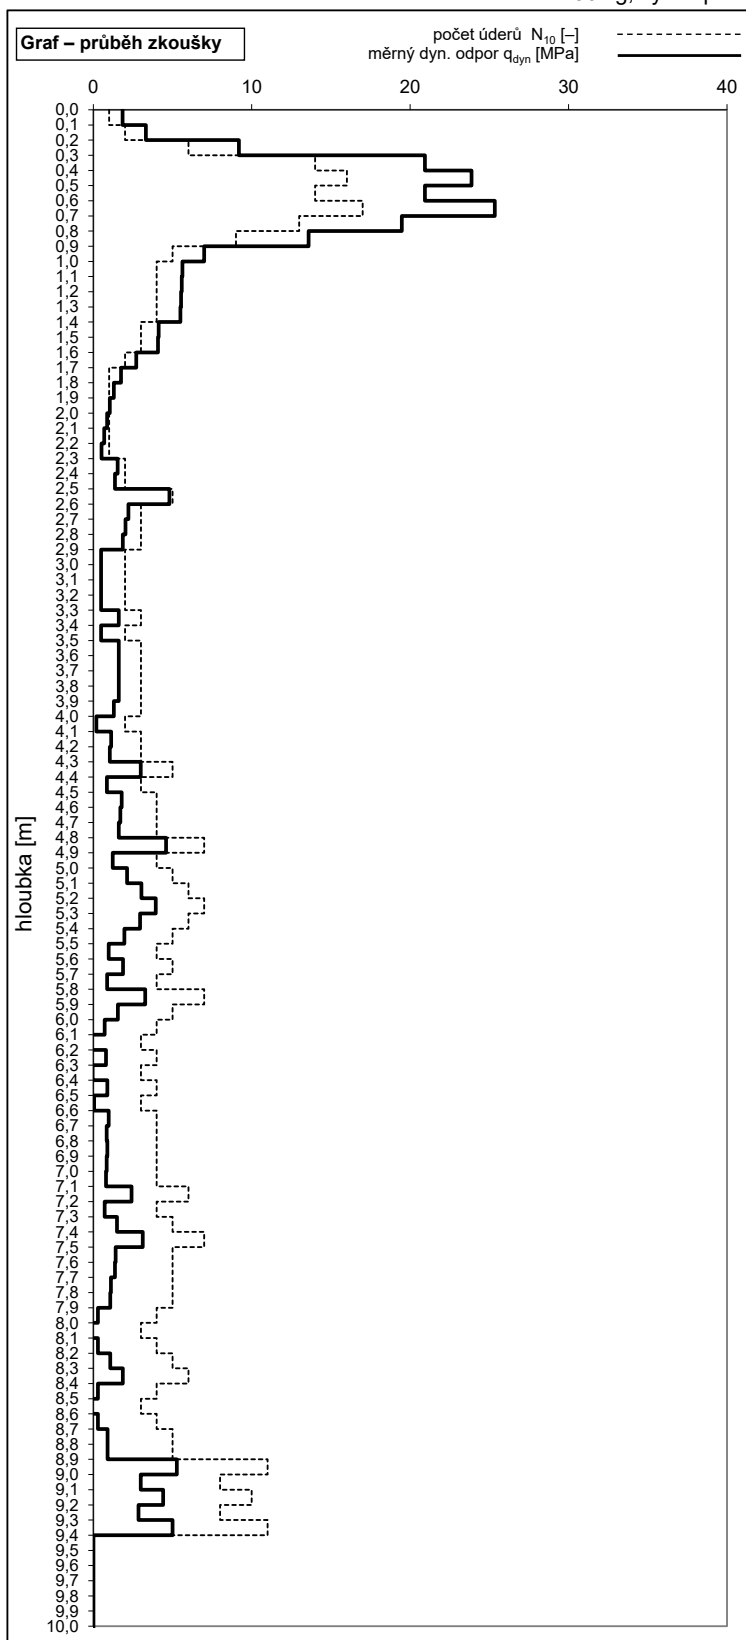


Dynamická penetrační zkouška DP 115 - km 180,856hmotnost beranidla 50 kg, výška pádu 0,5 m, průřez hrotu 15 cm²

Tabulka – výsledky měření

Interpretace

hloubka [m]	N_{10} [–]	M_v [Nm]	q_{dyn} [MPa]	Edef [MPa]	vrstvy Edef [MPa]
0.1	1		1.8	7.0	
0.2	2		3.3	12.6	
0.3	6		9.2	34.9	
0.4	14		20.9	79.6	
0.5	16		23.9	90.7	
0.6	14		20.9	79.6	
0.7	17		25.3	98.3	
0.8	13		19.5	74.0	
0.9	9		13.6	51.7	
1.0	5	0	7.0	26.6	
1.1	4		5.6	21.4	
1.2	4		5.6	21.2	
1.3	4		5.5	21.0	
1.4	4		5.5	20.9	
1.5	3		4.1	15.7	
1.6	3		4.1	15.5	
1.7	2		2.7	10.3	
1.8	1		1.7	6.6	
1.9	1	10	1.3	4.9	
2.0	1		1.0	4.0	
2.1	1		0.9	3.3	
2.2	1		0.7	2.6	
2.3	1		0.5	1.9	
2.4	2		1.5	5.8	
2.5	2		1.4	5.2	
2.6	5		4.8	18.2	
2.7	3		2.2	8.4	
2.8	3		2.0	7.7	
2.9	3	50	1.9	7.0	
3.0	2		0.5	1.9	
3.1	2		0.5	1.9	
3.2	2		0.5	1.9	
3.3	2		0.5	1.9	
3.4	3		1.6	6.1	
3.5	2		0.5	1.9	
3.6	3		1.6	6.1	
3.7	3		1.6	6.1	
3.8	3		1.6	6.1	
3.9	3	50	1.6	6.1	
4.0	3		1.3	4.9	
4.1	2		0.2	0.7	
4.2	3		1.1	4.3	
4.3	3		1.0	3.9	
4.4	5		3.0	11.3	
4.5	3		0.9	3.2	
4.6	4		1.8	6.5	
4.7	4		1.7	6.1	
4.8	4		1.6	6.1	
4.9	7	70	4.6	17.4	
5.0	4		1.2	8.1	
5.1	5		2.1	11.5	
5.2	6		3.0	15.0	
5.3	7		3.9	19.2	
5.4	6		2.9	11.2	
5.5	5		2.0	7.4	
5.6	4		1.0	3.7	
5.7	5		1.9	7.1	
5.8	4		0.9	3.3	
5.9	7	80	3.3	12.5	
6.0	5		1.6	6.9	
6.1	4		0.7	2.7	
6.2	3		-0.1	-0.5	
6.3	4		0.8	3.0	
6.4	3		0.0	-0.2	
6.5	4		0.9	3.4	
6.6	3		0.0	0.2	
6.7	4		1.0	3.7	
6.8	4		0.8	3.2	
6.9	4	70	0.9	3.4	
7.0	4		0.8	3.2	
7.1	4		0.8	3.0	
7.2	6		2.4	9.2	
7.3	4		0.7	2.7	
7.4	5		1.5	5.7	
7.5	7		3.1	11.8	
7.6	5		1.4	5.3	
7.7	5		1.4	5.2	
7.8	5		1.1	4.2	
7.9	5	80	1.1	4.1	
8.0	4		0.3	1.1	
8.1	3		-0.5	-1.9	
8.2	4		0.3	1.1	
8.3	5		1.1	4.1	
8.4	6		1.9	7.0	
8.5	4		0.3	1.1	
8.6	3		-0.5	-1.9	
8.7	4		0.3	1.1	
8.8	5		0.9	3.4	
8.9	5	80	0.9	3.4	
9.0	11		5.3	20.0	
9.1	8		3.0	11.3	
9.2	10		4.4	16.7	
9.3	8		2.9	10.8	
9.4	11		5.0	19.0	

šterové lože
násep $c_v = 64.1$ kPa
podloží Interpretace Nešvara 9/2021

SG Geotechnika a.s.

Geologická 988/4, 152 00 Praha 5

tel.: +420 234 654 111 fax: +420 234 654 112 e-mail: info@geotechnika.cz

Objednatel:	STRIX Chomutov, a.s.			
Název zakázky:	Dalovice - Hájek DP			
Číslo zakázky:	Měřili:	Zpracoval:	Schválil:	Datum:
19.0274.254Z28	Datel Miroslav + 2	Horváth Aleš	Ing. M. Kvarda	29.11.2019
Poznámka:	Osa 1. koleje.			