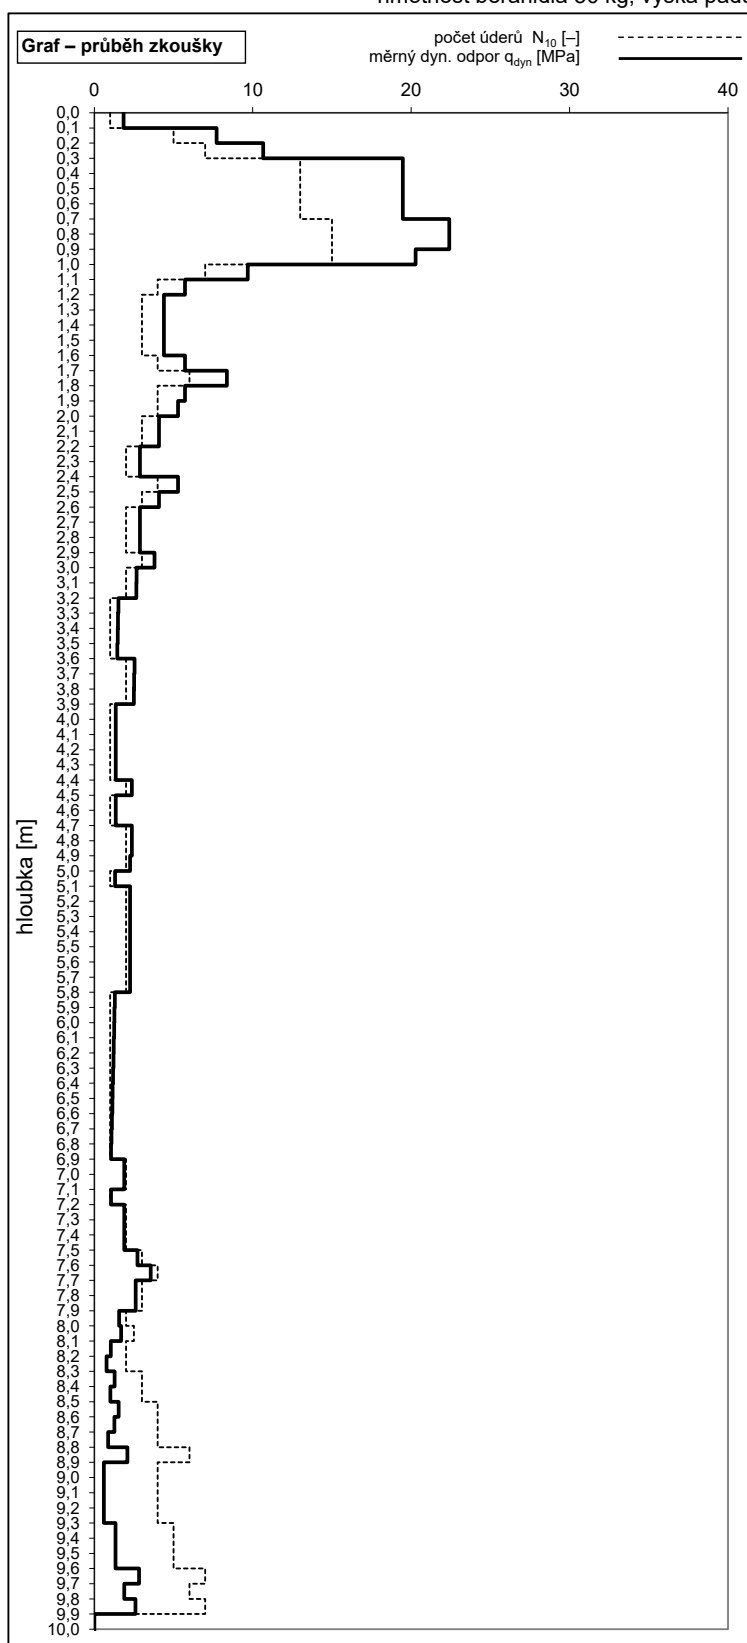


Dynamická penetrační zkouška DP 101 - km 180,319hmotnost beranidla 50 kg, výška pádu 0,5 m, průřez hrotu 15 cm²**Tabulka – výsledky měření****Interpretace**

hloubka [m]	N_{10} [-]	M_v [Nm]	q_{dyn} [MPa]	Edef [MPa]	Vrstvy Edef [MPa]
0.1	1		1.8	7.2	
0.2	5		7.7	30.1	
0.3	7		10.7	41.6	
0.4	13		19.5	75.9	
0.5	13		19.5	75.9	
0.6	13		19.5	75.9	
0.7	13		19.5	75.9	
0.8	15		22.4	87.4	
0.9	15		22.4	87.4	
1.0	15	0	20.3	79.1	
1.1	7		9.7	37.8	
1.2	4		5.7	22.3	
1.3	3		4.4	17.1	
1.4	3		4.4	17.1	
1.5	3		4.4	17.1	
1.6	3		4.4	17.1	
1.7	4		5.7	22.3	
1.8	6		8.4	32.6	
1.9	4	0	5.7	22.3	
2.0	4		5.3	20.6	
2.1	3		4.1	15.9	
2.2	3		4.1	15.9	
2.3	2		2.9	11.2	
2.4	2		2.9	11.2	
2.5	4		5.3	20.6	
2.6	3		4.1	15.9	
2.7	2		2.9	11.2	
2.8	2		2.9	11.2	
2.9	2	0	2.9	11.2	
3.0	3		3.8	14.8	
3.1	2		2.7	10.4	
3.2	2		2.6	10.3	
3.3	1		1.5	5.9	
3.4	1		1.5	5.8	
3.5	1		1.5	5.8	
3.6	1		1.5	5.7	
3.7	2		2.5	9.9	
3.8	2		2.5	9.8	
3.9	2	5	2.5	9.7	
4.0	1		1.3	5.2	
4.1	1		1.3	5.2	
4.2	1		1.3	5.2	
4.3	1		1.3	5.2	
4.4	1		1.3	5.2	
4.5	2		2.4	9.2	
4.6	1		1.3	5.2	
4.7	1		1.3	5.2	
4.8	2		2.4	9.2	
4.9	2	5	2.4	9.2	
5.0	2		2.3	8.8	
5.1	1		1.3	5.1	
5.2	2		2.3	8.8	
5.3	2		2.3	8.8	
5.4	2		2.3	8.8	
5.5	2		2.3	8.8	
5.6	2		2.3	8.8	
5.7	2		2.3	8.8	
5.8	2		2.3	8.8	
5.9	1	5	1.3	5.0	
6.0	1		1.3	4.9	
6.1	1		1.2	4.9	
6.2	1		1.2	4.8	
6.3	1		1.2	4.7	
6.4	1		1.2	4.6	
6.5	1		1.2	4.5	
6.6	1		1.1	4.4	
6.7	1		1.1	4.3	
6.8	1	10	1.1	4.2	
6.9	1		1.1	4.1	
7.0	2		1.9	7.4	
7.1	2		1.9	7.4	
7.2	1		1.1	4.1	
7.3	2		1.9	7.4	
7.4	2		1.9	7.4	
7.5	2		1.9	7.4	
7.6	3		2.7	10.6	
7.7	4		3.6	13.9	
7.8	3	10	2.6	10.2	
7.9	3		2.6	10.2	
8.0	2		1.6	6.1	
8.1	3		1.7	6.6	
8.2	2		1.0	4.0	
8.3	2		0.8	3.0	
8.4	3		1.3	5.0	
8.5	3		1.0	4.0	
8.6	4		1.5	6.0	
8.7	4		1.3	4.9	
8.8	4		0.9	3.4	
8.9	6	70.0	2.1	8.1	
9.0	4		0.6	2.3	
9.1	4		0.6	2.3	
9.2	4		0.6	2.3	
9.3	4		0.6	2.3	
9.4	5		1.3	5.2	
9.5	5		1.3	5.2	
9.6	5		1.3	5.2	
9.7	7		2.8	11.0	
9.8	7		1.9	7.4	
9.9	7	70.0	2.6	10.1	

$c_u = 84.4$ kPa
 $c_v = 63.1$ kPa

Interpretace Nešvara 9/2021

Podloží velmi špatné

SG Geotechnika a.s.

Geologická 988/4, 152 00 Praha 5

tel.: +420 234 654 111 fax: +420 234 654 112 e-mail: info@geotechnika.cz

Objednatel: STRIX Chomutov, a.s.

Název zakázky: Dalovice - Hájek DP

Číslo zakázky:
19.0274.254Z28Měřili:
Datel Miroslav + 2Zpracoval:
Horváth AlešSchválil:
Ing. M. KvardaDatum:
28.11.2019

Poznámka: Osa 1. koleje.