







19.10.2018

Počet listů: 2

Zakázkové číslo: 18-050-30-513		Jméno Tůma	Podpis 	 Pracoviště 211 – Ostrava
Datum: 10.2018	Ved. pracoviště	Navrátil		
Stupeň dokumentace: dPSŘ	Kreslil	Navrátil		
	Kontroloval	Navrátil		
Oprava PZZ v km 86,412, 87,045 a 94,548, 94,937 trati Praha Vysočany – Turnov PS 02 : PZS v km 94,548 a 94,937				2700
PZS v km 94,548 Obsazení svorkovnic a jističů				

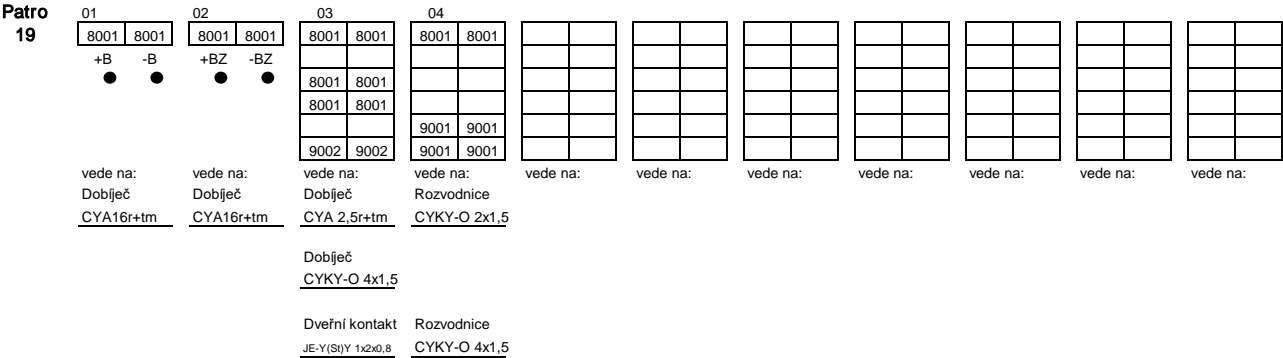

**Patro  
04**

01	05	09	13	17	21
8006 8006	8007 8007	5504** 5504**	7005 7005	<b>PBHL9</b>	8004 8004
8006 8006	8007 8007	5504** 5504**	7005 7005	<b>BSI004</b>	8004 8004
8006 8006	8007 8007	5504** 5504**	7005 7005	k.č. 410	8004 8004
8006 8006	8008 8008	5504** 5504**	7005 7005	ž. 1-4	8004 8004
8006 8006	8008 8008	5504** 5504**	7005 7005	vede na:	8004 8004
8006 8006	8012	8020 8020	8020 8020		SMO
vede na:	vede na:	vede na:	vede na:		k.č. 802
I.X-01					
02	06	10	14	18	22
8008 8008		8004* 8004*	7004 7004	<b>PBHL11</b>	
8008 8008		8014* 8014*	8004 8004	<b>BSI004</b>	
8008 8008		8014* 8014*	8019 8019	k.č. 414	
	8013 8013	8014* 8014*	8019 8019	ž. 1-4	
8012 8013	8013 8013	8014* 8014*	8019 8019	vede na:	vede na:
8013 8013	8013 8013	8014* 8014*	8019 8019		
vede na:	vede na:	vede na:	vede na:		
I.X-01		RD HL5	RD HL5		
I.X-02		k.č.676	k.č.605		
03	07	11	15	19	23
8009 8009	8010 8010	5504** 5504**	7005 7005	<b>PBHL12</b>	
8009 8009	8010 8010	5504** 5504**	7005 7005	<b>BSI004</b>	
8009 8009	8010 8010	5504** 5504**	7005 7005	k.č. 414	
8009 8009	8011 8011	5504** 5504**	7005 7005	ž. 5-8	
8009 8009	8011	5504** 5504**	7005 7005	vede na:	vede na:
8009 8009			8020 8020		
vede na:	vede na:	vede na:	vede na:		
II.X-01					
04	08	12	16	20	24
8011 8011	8015 8015	8004* 8004*		<b>PBHL13</b>	
8011 8011	8015 8015	8014* 8014*		<b>BSI004</b>	
8011 8011	8015 8015	8014* 8014*		k.č. 414	
	8015 8015	8014* 8014*		ž. 9-12	
	8015 8015	8014* 8014*		vede na:	vede na:
	8012	8014* 8014*			
vede na:	vede na:	vede na:	vede na:		
II.X-01	Výstr. B	RD HL7			
	k.č.101	k.č.678			

**Patro  
03**

01	05	09	13	17	21
8014 8014	8015 8015				PO1
8014 8014					v.č. 8001
8014 8014					
8014 8014					
8014 8014					
8012					
vede na:	vede na:	vede na:	vede na:	vede na:	
III.X-01	Výstr. B	RD HL7	RD HL7	RD HL7	
Výstr. A1,A2	K.č.101b	k.č.606	k.č.414	k.č.414	
K.č.102					
02	06	10	14	18	22
8014 8014	8015 8015				PO2
					v.č. 8001
vede na:	vede na:	vede na:	vede na:	vede na:	
III.X-02	Výstr. B	RD HL5	RD HL5	RD HL5	
Výstr. A		k.č.413			
K.č.102b					
03	07	11	15	19	23
8014 8014					PO3
					v.č. 8001
vede na:	vede na:	vede na:	vede na:	vede na:	
III.X-02					
Výstr. A					
K.č.102b					
04	08	12	16	20	
vede na:	vede na:	vede na:	vede na:	vede na:	

WAGO 2x do 16mm2 (283-601) + můstek (283-402)

19.10.2018

**Oprava PZS v km 86,412, 87,045 a 94,548, 94,937 trati Praha Vysočany - Turnov**  
**PS 02: PZS v km 94,548 a 94,937**  
 PZS v km 94,548  
 Obsazení spodních svorkovnic

**2702**